



## Instructions for calibrating Depth Gauges used to check CTI Micro Coax contacts.

Contact and Calibration equipment			
Contact	Depth Gauge	Calibration Pin	Marker Settings
40-120001-02	412670	5510999	60 - 40
40-120001-03	412670	5510999	60 - 40


Step 1) Remove Calibration Pin from back of the Depth Gauge.

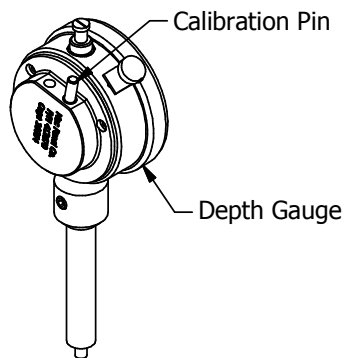


Step 2) Loosen Locking Screw on Depth Gauge body.

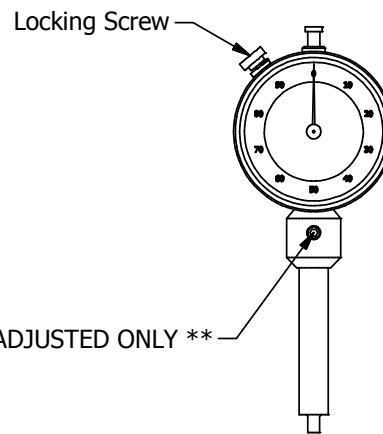


Step 3) Insert the non - knurled end of the Calibration Pin into the end of the Depth Gauge.

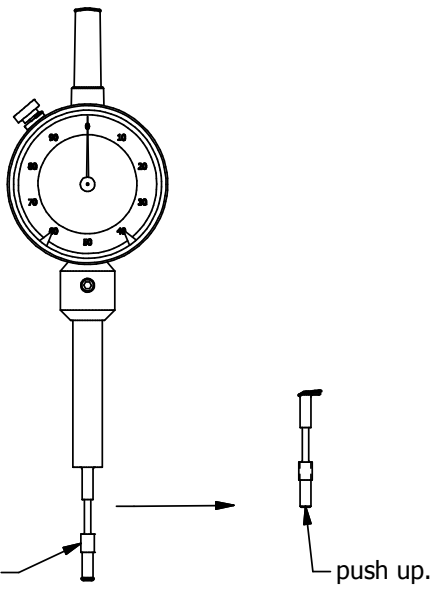

Step 4) With the Calibration Pin firmly seated, Rotate the Depth Gauge bezel until the needle reads " 0 ". Re-tighten the locking screw.

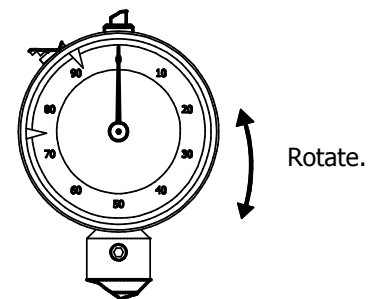

Step 5) With the Calibration Pin still firmly seated, rotate the two markers to the numbers specified in the table on Sheet 1.

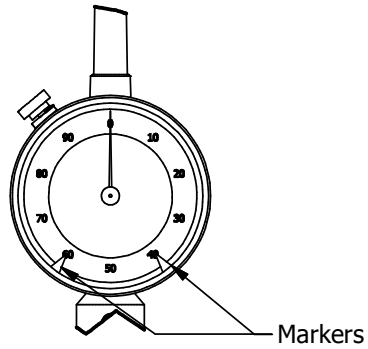

Step 6) Remove the Calibration Pin and return to the body of the Depth Gauge for future use.

*Your Depth Gauge is now properly calibrated and ready to check the appropriate contact.*

---

Customer Notes.